


KEY

- Main Filter
- Land Drain
- Ditch
- Highways drainage
- Storage
- Water Course Segregation
- Properties with history of flooding
- Properties with high level flooding
- Run off from hills
- Overflowing drain

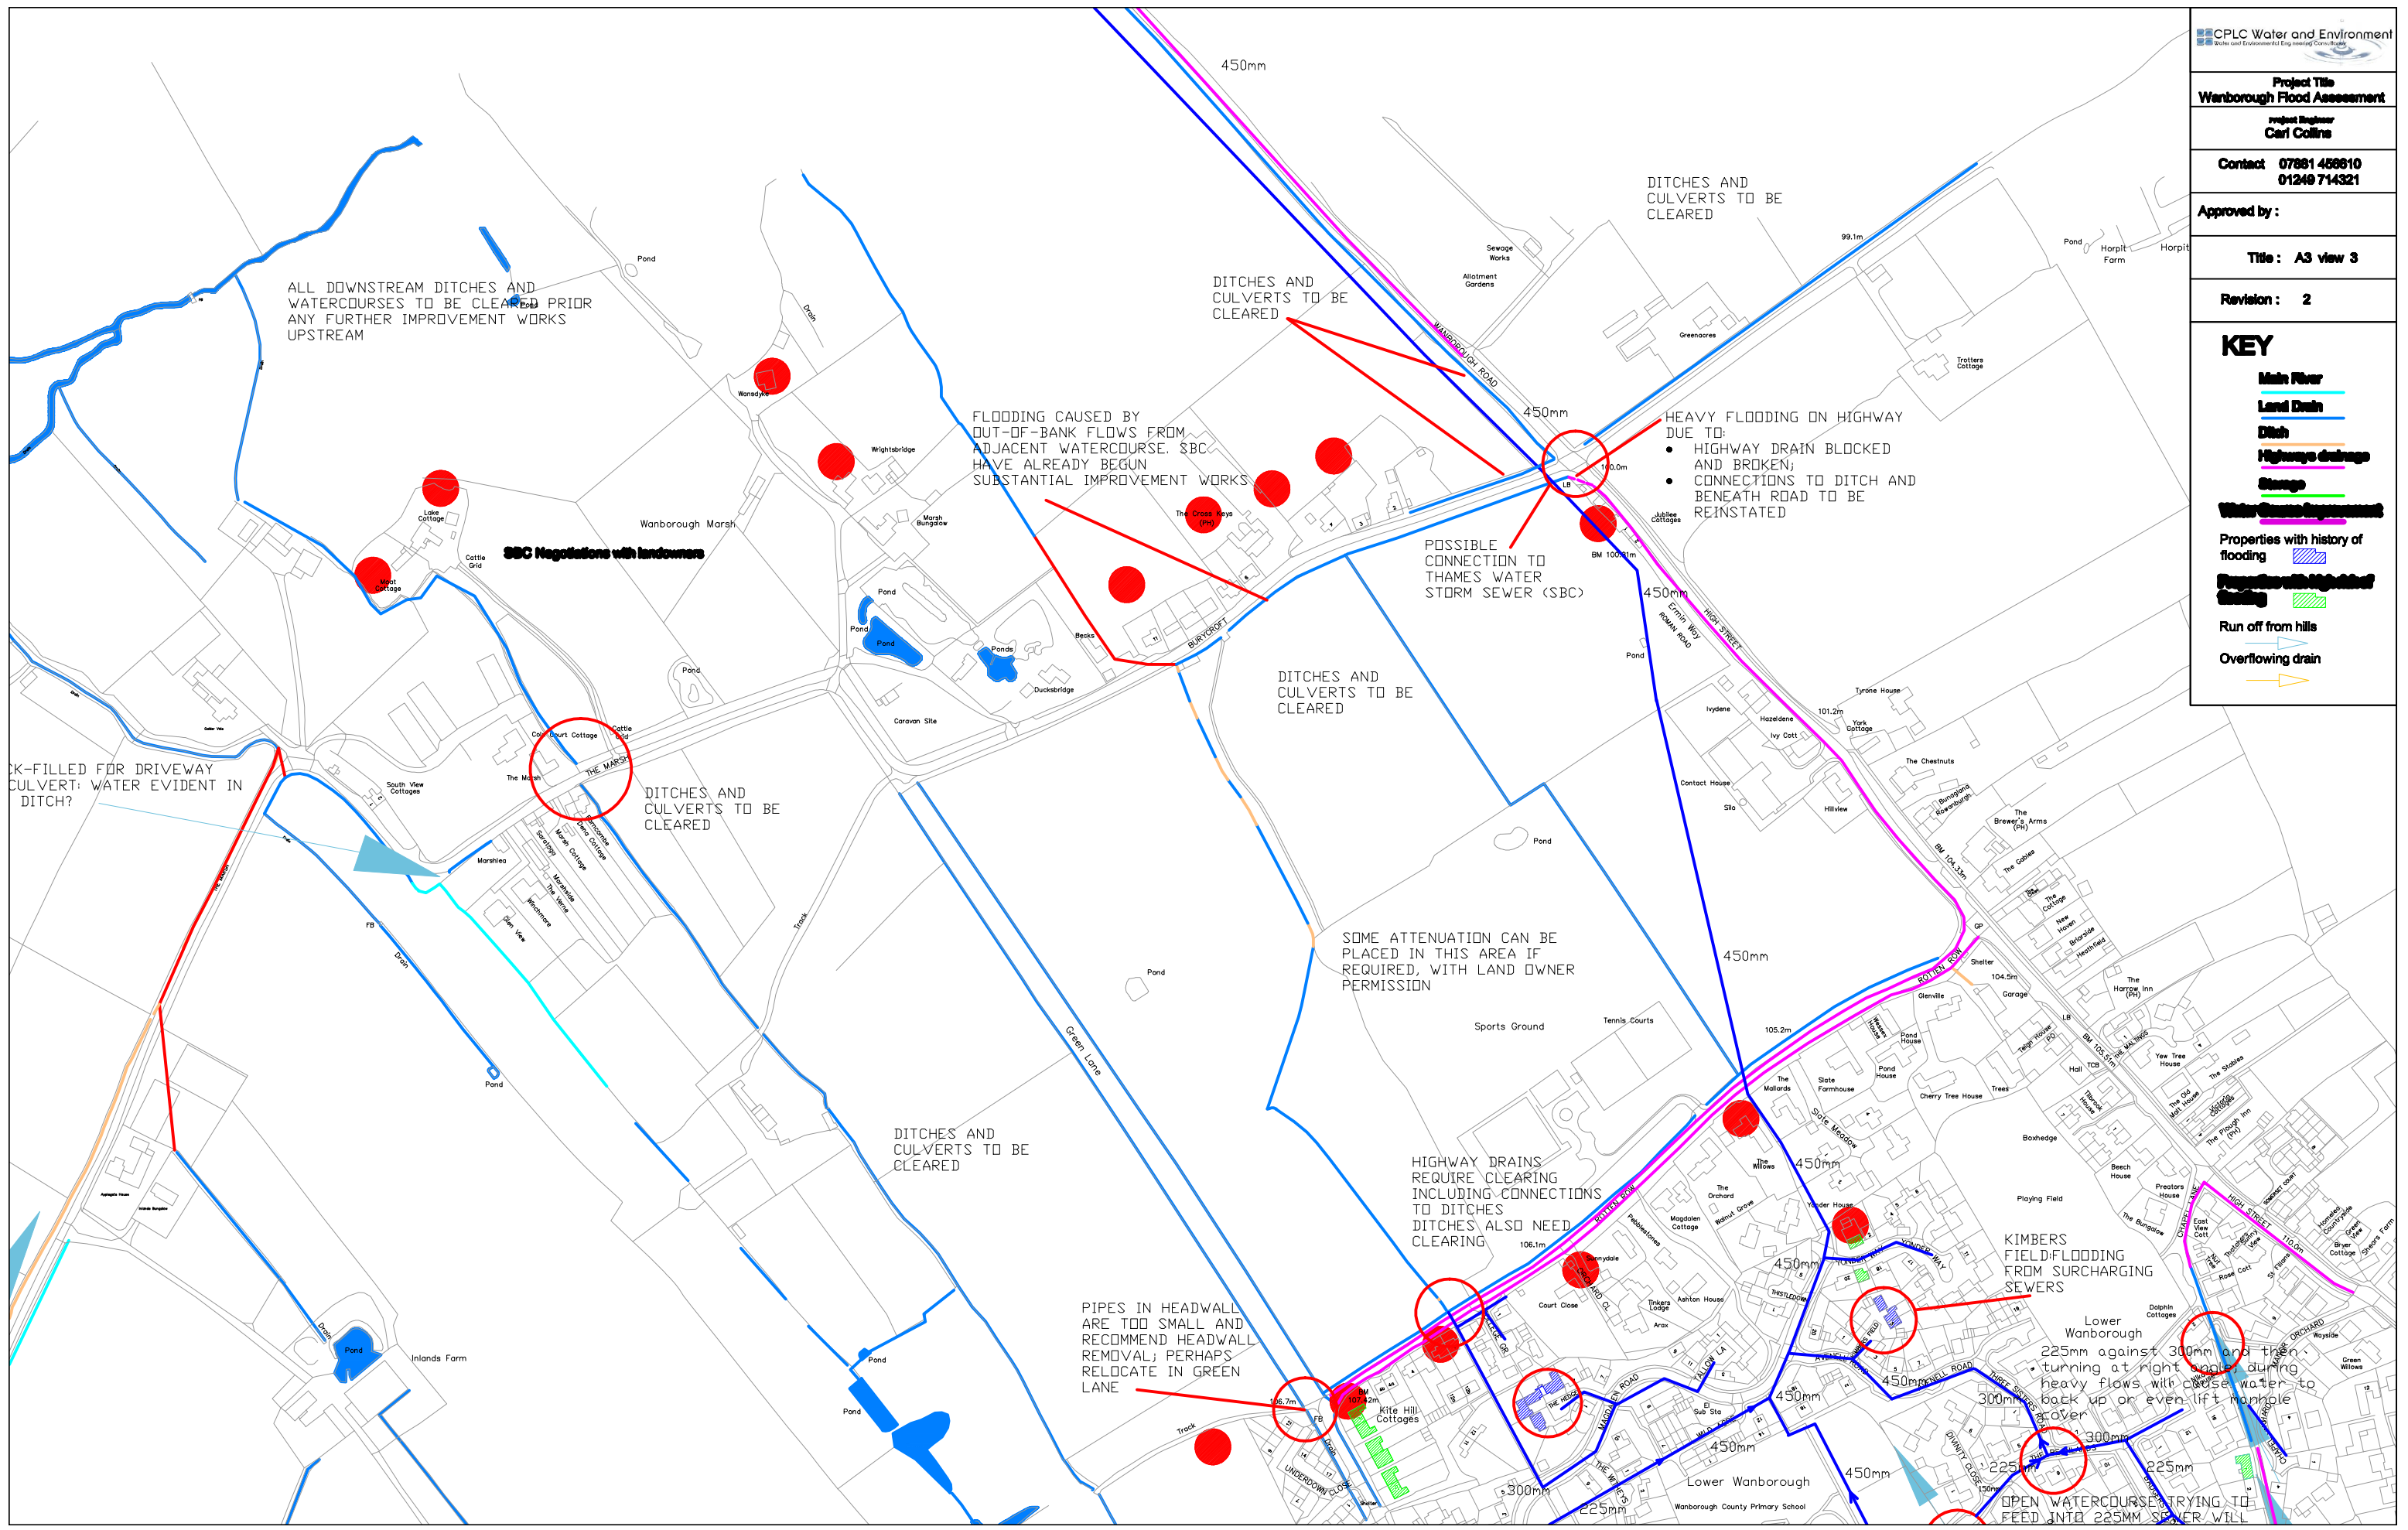

ALL DOWNSTREAM DITCHES AND WATERCOURSES TO BE CLEARED PRIOR ANY FURTHER IMPROVEMENT WORKS UPSTREAM

DITCHES AND CULVERTS TO BE CLEARED

DITCHES AND CULVERTS TO BE CLEARED

FLOODING CAUSED BY OUT-OF-BANK FLOWS FROM ADJACENT WATERCOURSE. SBC HAVE ALREADY BEGUN SUBSTANTIAL IMPROVEMENT WORKS

HEAVY FLOODING ON HIGHWAY DUE TO:
 • HIGHWAY DRAIN BLOCKED AND BROKEN;
 • CONNECTIONS TO DITCH AND BENEATH ROAD TO BE REINSTATED

POSSIBLE CONNECTION TO THAMES WATER STORM SEWER (SBC)

DITCHES AND CULVERTS TO BE CLEARED

SBC Negotiations with landowners

DITCHES AND CULVERTS TO BE CLEARED

SOME ATTENUATION CAN BE PLACED IN THIS AREA IF REQUIRED, WITH LAND OWNER PERMISSION

DITCHES AND CULVERTS TO BE CLEARED

HIGHWAY DRAINS REQUIRE CLEARING INCLUDING CONNECTIONS TO DITCHES DITCHES ALSO NEED CLEARING

PIPES IN HEADWALL ARE TOO SMALL AND RECOMMEND HEADWALL REMOVAL; PERHAPS RELOCATE IN GREEN LANE

KIMBERS FIELD FLOODING FROM SURCHARGING SEWERS
 Lower Wanborough
 225mm against 300mm and then turning at right angle during heavy flows will cause water to back up on even lift manhole cover
 300mm
 300mm
 225mm
 225mm
 OPEN WATERCOURSE TRYING TO FEED INTO 225MM SEWER WILL

CK-FILLED FOR DRIVEWAY CULVERT; WATER EVIDENT IN DITCH?